




BSW Thread WHITWORTH
Filetage WHITWORTH
Rosca WHITWORTH




DIN 11 Norm
Norme DIN 11
Norma DIN 11

MACHINE CUTTING TAP
TARAU MACHINE Á COUPE
MACHO DE CORTE A MÁQUINA


NORMAL CLASS **DIN 371** **HSS E** **BRIGHT UNCOATED**




A **B** **F1** **H1** **N2** **N3**



| 9612021 | Ø | P | L | l1 | d | DIN | □ | ●Ø |
|-----------------|--------|----|----|----|-----|-----|-----|------|
| 961202100180400 | W 1/8" | 40 | 56 | 11 | 3,5 | 371 | 2,7 | 2,55 |
| 961202100316240 | W 3/16 | 24 | 70 | 14 | 6 | 371 | 4,9 | 3,7 |
| 961202100140200 | W 1/4" | 20 | 80 | 16 | 7 | 371 | 5,5 | 5,1 |
| 961202100516180 | W 5/16 | 18 | 90 | 18 | 8 | 371 | 6,2 | 6,5 |
| 961202100380160 | W 3/8" | 16 | 90 | 18 | 9 | 371 | 7 | 7,9 |

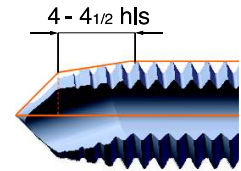

BSW Thread WHITWORTH
Filetage WHITWORTH
Rosca WHITWORTH




DIN 11 Norm
Norme DIN 11
Norma DIN 11

MACHINE CUTTING TAP
TARAU MACHINE Á COUPE
MACHO DE CORTE A MÁQUINA

NORMAL CLASS **DIN 376** **HSS E** **BRIGHT UNCOATED**



A **B** **F1** **H1** **N2** **N3**



| 9613021 | Ø | P | L | l1 | d | DIN | □ | ●Ø |
|-----------------|--------|----|-----|----|-----|-----|-----|------|
| 961302100140200 | W 1/4" | 20 | 80 | 16 | 4,5 | 376 | 3,4 | 5,1 |
| 961302100380160 | W 3/8" | 16 | 90 | 18 | 7 | 376 | 5,5 | 7,9 |
| 961302100716140 | W 7/16 | 14 | 100 | 22 | 8 | 376 | 6,2 | 9,25 |
| 961302100120120 | W 1/2" | 12 | 110 | 25 | 9 | 376 | 7 | 10,5 |
| 961302100580110 | W 5/8" | 11 | 110 | 28 | 12 | 376 | 9 | 13,5 |
| 961302100340100 | W 3/4" | 10 | 125 | 32 | 14 | 376 | 11 | 16,5 |
| 961302110000080 | W 1" | 8 | 160 | 36 | 20 | 376 | 16 | 22 |

